




July 26, 2018

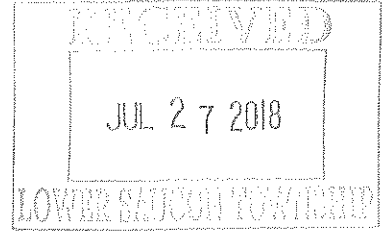

Mr. Don Hallock, District General Manager
IESI PA Bethlehem Landfill
2335 Applebutter Road
Bethlehem, PA 18015

Re: Engineer's Monthly Status Report
IESI PA Bethlehem Landfill
Lower Saucon Township, Northampton County
I.D. No. 100020

Dear Mr. Hallock:

This Engineer's Status Report is for the month of June. The Engineer's meeting was held at the landfill on Tuesday, July 24. This report is informational only, without deadlines, and a response is required only if objections are taken to the items mentioned.

A. Pending Permit Applications

1. Nothing pending at this time.

B. Construction Schedule

1. Construction in the southeast realignment area (SE-1) is proceeding. Secondary liner installation has been delayed periodically due to rainy weather. There was a crew on site the morning of my visit.
2. Cells 4A and 4B were being filled at the time of my visit. Average amount of waste accepted was approximately 1600 tons per day.

C. Groundwater

1. Monitoring Wells: Total number of wells = 29
2. Abatement Wells: Total number of active wells = 10

D. Gas Management

1. There are 119 vertical gas wells currently installed. There are 44 horizontal collectors in operation. Four new wells were drilled recently and went on line this week.
2. The flare was operating at approximately 1520 scfm and 1654°F at the time of my visit.

S

ROUTING

- Council
- Manager *orig*
- Asst. Mgr.
- Zoning
- Finance
- Police
- P. Works
- P/C
- P & R
- EAC
- Engineer
- Solicitor
- Planner
- Landfill
- EMC
- Other *website*

Northeast Regional Office

2 Public Square | Wilkes-Barre, PA 18701-1915 | 570.826.2511 | Fax 570.826.5448 | www.dep.pa.gov

Mr. Don Hallock

July 26, 2018

3. The BRE plant was operating two compressors, at a total of 1500 scfm at the time of my visit. No odors were observed outside the plant at that time.

E. Leachate Management

1. Average daily leachate flow for the month of June was 70,535 gallons; the total leachate generated for the month was 2,116,063 gallons.

All flows went directly to the Bethlehem wastewater treatment plant.

F. Site Observations

1. Litter: No issues observed.
2. Odor: No offsite odors were detected at the time of this visit.
3. Daily Cover: No issues observed.
4. Intermediate Cover: No issues observed.

G. Miscellaneous:

Enclosed as part of this report is the monthly Engineer's Report from IESI Landfill for June, which includes site operations, radiation monitoring, truck safety, leachate management, and report submittals.

If you have any questions concerning this report, please contact me.

Sincerely,



Susan E. French
Waste Management Program

Enclosure

cc: Nicholas Rogers, IESI PA Landfill (w/enc.)
Dave Pannucci, IESI PA Landfill (w/enc.)
Ms. Leslie Huhn, Lower Saucon Township (w/enc.)
Chris Taylor, Hanover Engineering (w/enc.)
Kevin N. Bodner, Martin and Martin, Inc. (w/enc.)

PADEP ENGINEER'S REPORT

June 2018

Date: July 24, 2018

1. Site Operations:
 - a. Average Daily Volume 1375
 - b. Maximum Daily Volume 1800
 - c. Permitted Area 201
 - d. Permitted Disposal area 133.5
 - e. Capped acres 71.8
 - f. Constructed acres 82.7

2. Radiation Monitoring: **June**
 - a. Number of trucks that tripped the monitor 5
 - b. Number of trucks **on hold** or rejected 0

3. Truck Safety & Overweight: **June**
 - a. Number of Overweight Trucks 59
 - b. Number of Trucks Rejected Due To Overweight 0

4. Leachate Management:
 - a. Type of Discharge **Direct to WWTP**
 - b. Total Leachate Generated **June gal. 2,116,063**
 - c. Untreated Effluent Discharge to WWTP **100%**
 - d. Average Daily Flow gal. **70,535**
 - e. Leachate hauled Offsite **0%**
 - f. Detection zone flow (Max/week in g/a/d) **June**
LMC-6 – (20.0) LMC-7 – (10.2) LMC-8– (16.4) PS-1 – (0.4) PS-2 – (<1) PS-3 – (<1)

5. Leachate Storage:
 - a. Total Influent Storage Capacity **1,490,000**
 - b. 25% Influent Storage Capacity **372,500**
 - c. Current Volume stored **est. 20% Storm water for Dust Control**

6. Gas Management – Drilled 4 new wells and 8 re-drills
 - a. Number of vertical wells (LFG extraction wells and cleanouts) **119**
 - b. Number of horizontal wells **44**
 - c. Number of Migration wells **17**

7. Groundwater
 - a. Number of monitoring wells **29**
 - b. Abatement wells (TW-1 shut off per DEP approval) **10**

8. Reports Submitted:

Groundwater	Quarterly groundwater report	
Leachate	Monthly Leachate demand report	
Quarterly		
Other	Form U Submittals	electronic submittal

